



Preliminary Information

PIT5605B Rattle Noise from 60 /40 Rear Seat

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2020	All	All	All	All
GMC	Canyon	2015 - 2020	All	All	All	All

Involved Region or Country:	North America
Additional RPO/s:	AJ2
Condition:	Rattle noise from the rear 60/40 seat
Cause:	Misalignment of the seat back latch

Correction:

Inspect and adjust the rear seat using the information below.

Service Procedure:

Inspect the alignment of the bumpers in the latch in relation to the striker. (Illustration 1 below.)

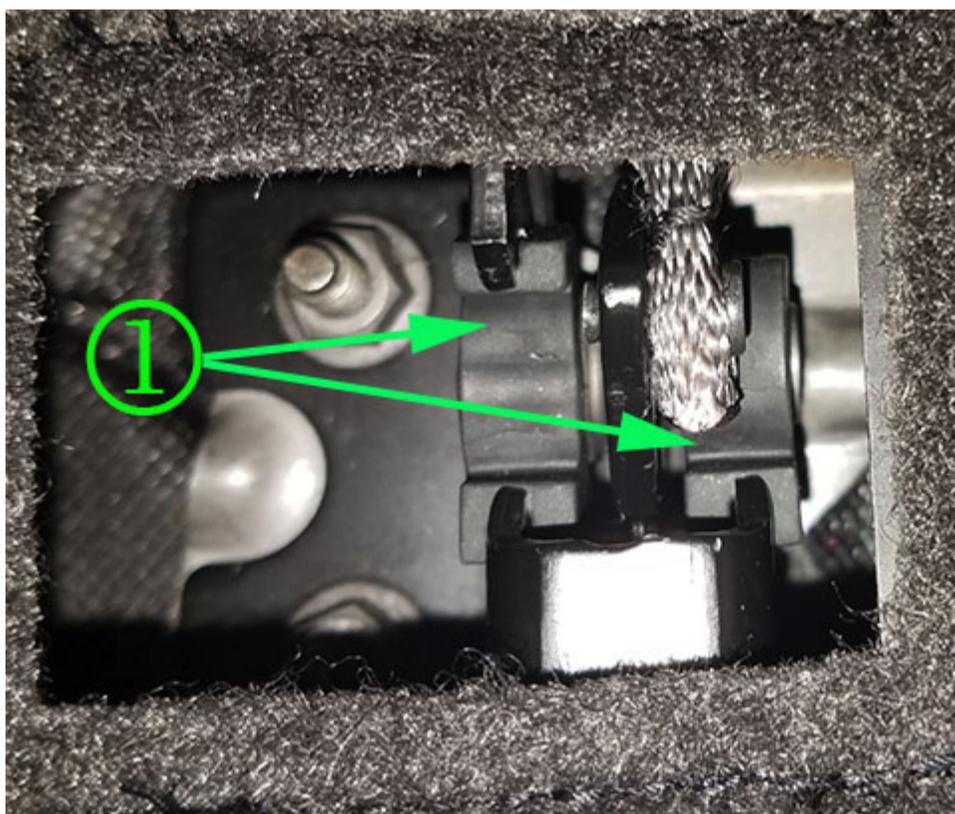


Illustration #2 below shows both bumpers engaged .

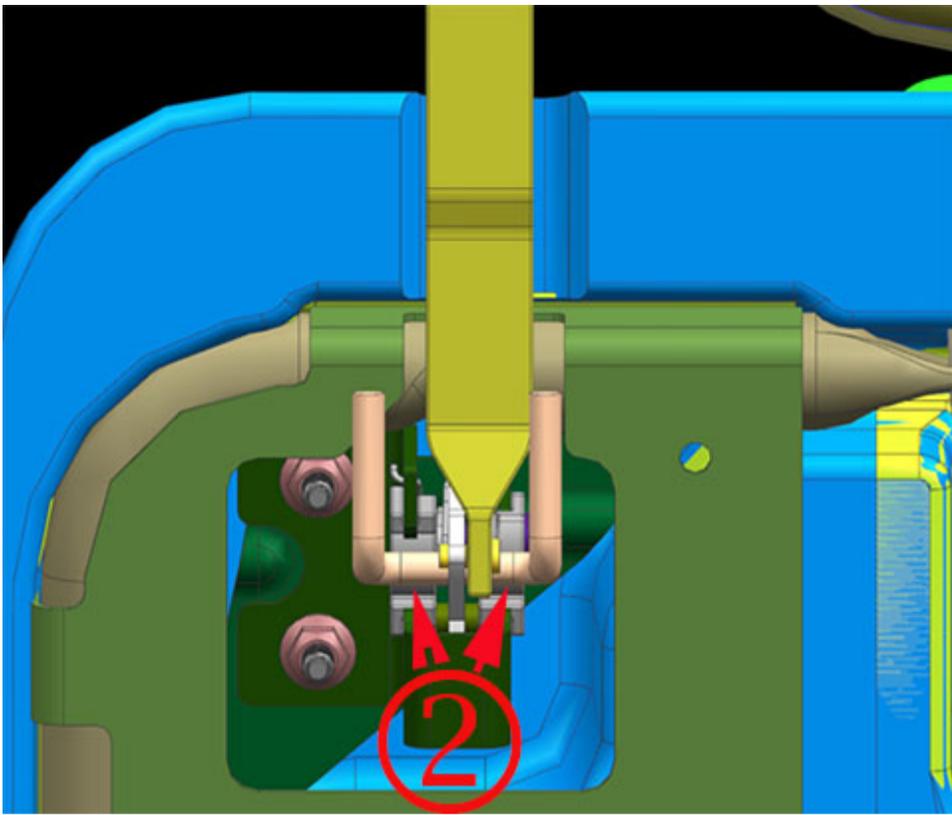


Illustration #3 shows the latch aligned too far right , only one bumper engaged.


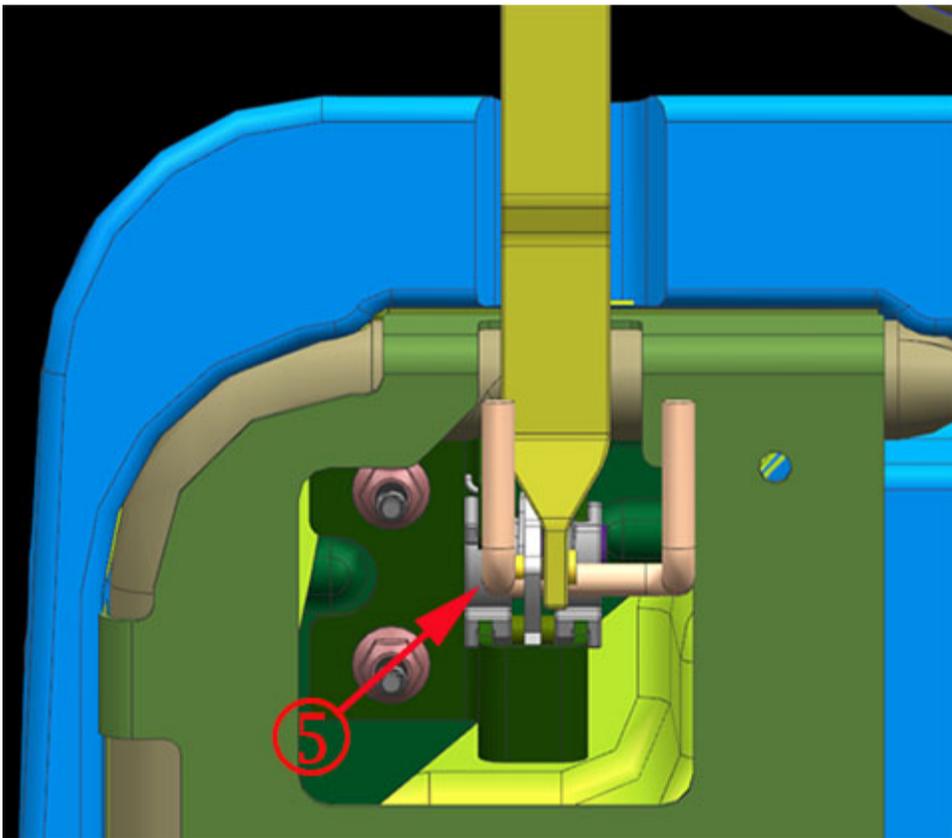


Illustration #4 shows latch aligned too far left , only one bumper engaged.



To align the striker to the insulators , loosen the nuts on the studs left and right shown below and move the seat left or right until centered.

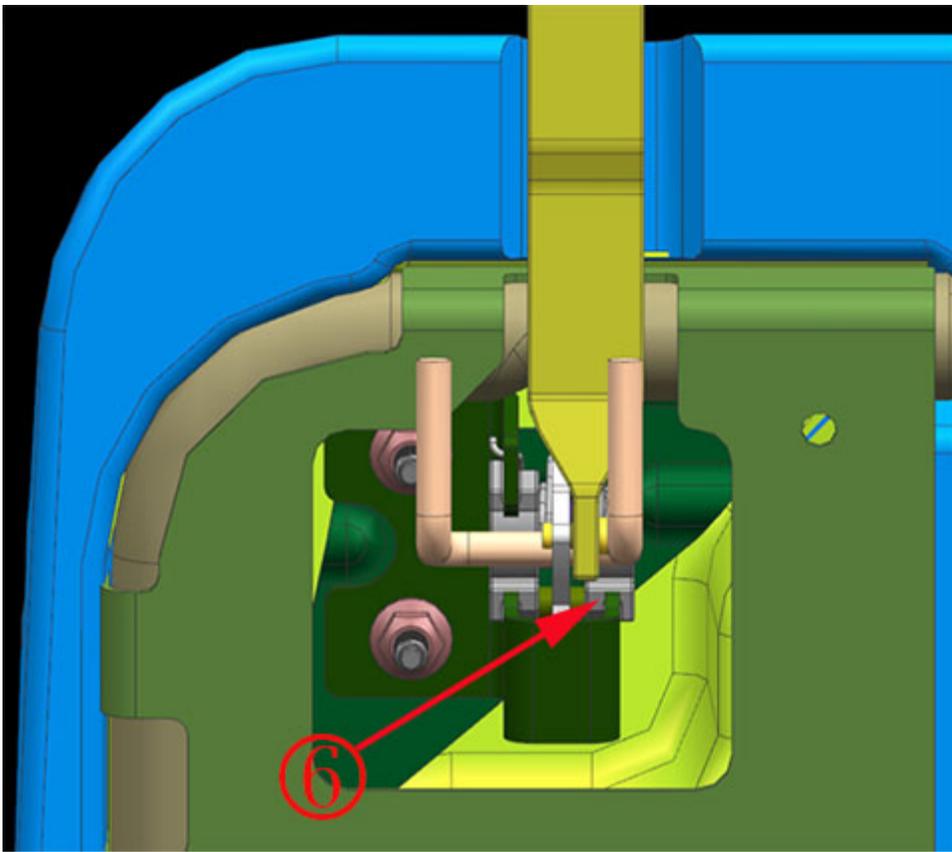

Once aligned retorque the nuts on the studs to 45 Nm (33 lbs ft) and verify repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation:	Description:	Labor Time:
7080538	Adjust Rear Seat Latches	.3 hrs.

Version History

Version	3
Modified	12/18/2017 - Created on 10/17/2018- Updated to Add 18 and 19 model years. 10/17/2019- Updated to add 2020 model year.



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.